

# WMP / WXMP


Ideal for microscope work; highest performance via active soldering tip; cartridge type tip.

40 W, 12 V



- Fastest heat up & recovery on the market
- Excellent reaction time with finest tips
- Optimal for soldering under microscope
- Rapid hot tip-change; no tool required

## Chisel

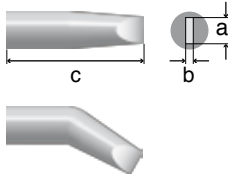

RT		Ø a mm	b mm	Order-no.
	RT 1SC	0,4	0,15	T005 44 612 99
	RT 1SCNW*	0,3	0,1	T005 44 626 99
	RT 3	1,3	0,4	T005 44 603 99
	RT 4	1,5	0,4	T005 44 604 99
	RT 8	2,2	0,4	T005 44 608 99
	RT 9	0,8	0,4	T005 44 609 99
	RT 11	3,6	0,9	T005 44 611 99
	RT 5 30°	0,8	0,4	T005 44 605 99

Type	Ø a mm	b mm	Order-no.	
	RT 1SCMS	0,4	0,15	T005 44 615 99
	RT 1SCNWMS*	0,3	0,1	T005 44 626 71
	RT 3MS	1,3	0,4	T005 44 616 99
	RT 4MS	1,5	0,4	T005 44 618 99
	RT 8MS	2,2	0,4	T005 44 622 99
	RT 9MS	0,8	0,4	T005 44 623 99
	RT 11MS	3,6	0,9	T005 44 631 99
	RT 5MS30°	0,8	0,4	T005 44 619 99
	RT 3XMS30°	1,3	0,5	T005 44 603 73

## Soped



Type	a mm	Order-no.	
	RT 6 45°	1,2	T005 44 606 99


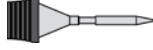
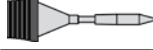
Type	a mm	Order-no.	
	RT 6MS45°	1,2	T005 44 620 99


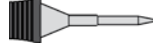



MS tips: separate grounded

\* none wettable


## Conical





Type	Ø a mm	Order-no.
RT 1 	0,2	T005 44 601 99
RT 1NW* 	0,1	T005 44 625 99
RT 2 	0,8	T005 44 602 99

Type	Ø a mm	Order-no.
RT 1MS 	0,2	T005 44 614 99
RT 1NWMS* 	0,1	T005 44 625 71
RT 2MS 	0,8	T005 44 617 99
RT 12MS25° 	0,5	T005 44 632 99
RT 13MS30° 	0,4	T005 44 633 99

## Gull Wing





Type	Ø a mm	b mm	Order-no.
RT 10GW 	1,2	2,0	T005 44 610 99

Type	Ø a mm	b mm	Order-no.
RT 10GWMS 	1,2	2,0	T005 44 624 99

## Knife

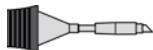


Type	Ø a mm	Order-no.
RT 7 45° 	2,2	T005 44 607 99

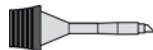Type	Ø a mm	Order-no.
RT 7MS45° 	2,2	T005 44 621 99

MStips: separate grounded

## Measuring tip

Type	Order-no.
Measuring tip 	T005 44 613 99

\* none wetttable